


# Feed through terminals with tab connection

## AST 1

## AST 4

## AST 5

## SAK 4 S/35 SAK 4 SS/35

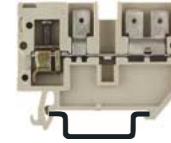

### Dimensions/Approvals

Width/length/height (mm) with TS 35 x 7.5

Insulation stripping length/clamping screw/screwdriver blade

### Rated data

Rated voltage/rated current/rated cross-section  
Rated voltage clamping yoke  
Rated voltage 6.3/2.8 mm push-on tab  
Rated impulse voltage VDE 0110/1.89/pollution severity

### Further technical data

Tightening torque range Nm  
Torque setting with DMS 2 electric screwdriver

### Clampable conductor

Solid H07V-U mm<sup>2</sup>  
Stranded H07V-R mm<sup>2</sup>  
Flexible H07V-K mm<sup>2</sup>  
Flexible H07V-K with ferrule according to DIN 46 228/1 mm<sup>2</sup>  
Plug gauge according to IEC 60 947-7-1 Size  
Continuous current of cross-connection 2-pole A

### UL/CSA rated data

Voltage/current/conductor size UL  
Voltage/current/conductor size CSA

### Ordering data

Version  
Slotted beige Wemid  
Unslotted beige Wemid

6,5/58/46

500 V<sup>1</sup>/ - /2,5

2,5 / 1 mm<sup>2</sup>

6 kV/3

Nm

(QL 2...10) 36

Cat. No. Qty.

**0699600000** 50

**0664800000** 50

6,5/40/40

500 V<sup>1</sup>/ - /2,5

2,5 mm<sup>2</sup>

2,5 / 1 mm<sup>2</sup>

0,4...0,7

1

0,5...4

1,5...2,5

0,5...2,5

0,5...2,5

A 2

Cat. No. Qty.

**0460400000** 100

6,5/58/46

500 V<sup>1</sup>/ - /2,5

4 mm<sup>2</sup>

2,5 / 1 mm<sup>2</sup>

0,5...1,0

2

0,5...6

1,5...2,5

0,5...4

0,5...4

A 4

Cat. No. Qty.

**0664900000** 50

**0699700000** 50

6,5/40/49,5

500 V<sup>1</sup>/16 A/2,5

4 mm<sup>2</sup>

2,5 / 1 mm<sup>2</sup>

0,5...1,0

2

0,5...6

1,5...2,5

0,5...4

0,5...4

A 4

Cat. No. Qty.

SAK 4 S **0630300000** 100

(screw-/tab-connection = s)

SAK 4 SS **0630400000** 100

(tab-/tab-connection = ss)

### End plate/Partition/Small partition (Thickness mm)

Beige Wemid  
Beige PA

Type Cat. No. Qty.  
AP (1,5) **0266400000** 20  
TSch 1 **0319160000** 100

Type Cat. No. Qty.  
AP (1,5) **0460490000** 20  
TSch 1 **0319160000** 100

Type Cat. No. Qty.  
AP (1,5) **0266400000** 20  
TSch 1 **0319160000** 100

Type Cat. No. Qty.  
AP (1,5) **0105100000** 20  
TSch 1 **0319160000** 100



AP TSch

### Cross-connection

2-pole Q 2 **0336700000** 50  
3-pole Q 3 **0336800000** 50  
4-pole Q 4 **0336900000** 50  
10-pole Q 10 **0368800000** 20

2-pole Q 2 **0336700000** 50  
3-pole Q 3 **0336800000** 50  
4-pole Q 4 **0336900000** 50  
10-pole Q 10 **0368800000** 20

2-pole Q 2 **0336700000** 50  
3-pole Q 3 **0336800000** 50  
4-pole Q 4 **0336900000** 50  
10-pole Q 10 **0368800000** 20

QL 2 **0130600000** 100  
QL 3 **0130700000** 100  
QL 4 **0130800000** 50  
QL 10 **0338200000** 20

Q 3 QL BS

### Plug adaptor

2-pole  
3-pole  
4-pole  
5-pole  
8-pole

STA 2.5/2 **0165860000** 100  
STA 2.5/3 **0165960000** 50  
STA 2.5/4 **0190360000** 50  
STA 2.5/5 **0166060000** 50  
STA 2.5/8 **0166160000** 50

### Test plug/Socket

Plug test socket without using QL for TS 32

StB 14 **0168600000** 50

StB 14 **0168600000** 50

StB 14 **0168600000** 50

PS StB

PS 2.3 **0180400000** 20

PS 2.3 **0180400000** 20

PS 2.3 **0180400000** 20

### Insulating sleeves

IH 2.8 **0386060000** 100  
IH 6.3 **0386260000** 100

IH 2.8 **0386060000** 100  
IH 6.3 **0386260000** 100

IH 2.8 **0386060000** 100  
IH 6.3 **0386260000** 100

IH 2.8 **0386060000** 100  
IH 6.3 **0386260000** 100

### Marking tags

Print  
Consecutive horizontal

DEK 6.5 section "Accessories"

DEK 6 section "Accessories"

DEK 6.5 section "Accessories"

DEK 6.5 section "Accessories"

### Mounting rails, end brackets, further marking material see "Accessories"

<sup>1</sup>) With insulating sleeve

<sup>2</sup>) Touch safe with ADP4 cover